



ULTRA TESTING & RESEARCH LABORATORY

(An ISO 9001:2015, OHSAS 45001:2018, 14001:2015 (EMS) Certified)

Laboratory: C-43, Sector-88, Phase-II, Noida, U.P.

Ph. No.: +91-9971912476, 9350952231

E-mail: ultraresearchlab@gmail.com

Website: http://www.ultralabnoida.com



TC-8198

TEST REPORT

Water Sample Analysis
Discipline/Group-Chemical/Water

Report Code : W-04062021-01

Issue Date : 07/06/2021

Issued To

: GOOD LUCK PUBLIC SCHOOL
B-20, BEGUMPUR EXT.
BARWALA ROAD, BEGUMPUR, DELHI

Sample Description : Drinking Water
Sample Packing : Sample Collected in PVC Bottle
Sample Received On : 04/06/2021
Sample Given By : Customer
Sample Quantity : 1.0 Litre
Analysis Duration : 04/06/2021 To 07/06/2021

RESULTS

As per IS 10500:2012

S.No	Parameter	Test Method	Results	Units	Acceptable Limit	Permissible Limit in the Absence of Alternate Source
1	pH	IS:3025(Part-11)	6.98	-	6.5-8.5	-
2	Colour	IS:3025(Part-04)	<5.0	Hazen	5	15
3	Odour	IS-3025(Part-05)	Agreeable	-	Agreeable	Agreeable
4	Taste	IS:3025(Part-07)	Agreeable	-	Agreeable	Agreeable
5	Turbidity	IS-3025(Part-10)	<0.5	NTU	1	5
6	Total Hardness (as CaCO ₃)	IS:3025(Part-21)	56.00	mg/l	200	600
7	Calcium(as Ca)	IS:3025(Part-40)	9.60	mg/l	75	200
8	Magnesium(as Mg)	IS:3025(Part-46)	7.78	mg/l	30	100
9	Chloride(as Cl)	IS:3025(Part-32)	19.28	mg/l	250	1000
10	Iron(as Fe)	IS:3025(Part-53)	<0.05	mg/l	0.3	No Relaxation
11	Fluoride(as F)	IS:3025(Part-60)	<0.1	mg/l	1	1.5
12	Free Residual Chlorine	IS:3025(Part-26)	<0.1	mg/l	0.2	1
13	Total Dissolved Solid	IS:3025(Part-16)	158	mg/l	500	2000

End Of Report

Remarks :- The sample confirm to IS10500:2012 for drinking water at the above test only. So Water fit for drinking purpose.

Note:-

- 1 The results given above are related to the tested sample, for various parameters, as observed at the time of sampling. The customer asked for the above tests only.
- 2 This test report will not be used for any publicity/legal purpose.
- 3 The test samples will be disposed off after two weeks from the date of issue of test report, unless until specified by the customer.
- 4 The Report can not be used as evidence in a court of law without the written approval of the lab.

Checked By

For ULTRA TESTING & RESEARCH LABORATORY

(Authorized Signatory)

Assuring you of best our services at all times.



ULTRA TESTING & RESEARCH LABORATORY

(An ISO 9001:2015, ISO 45001:2018, ISO 14001:2015 Certified)

Laboratory: C-43, Sector-88, Phase-II, Noida, U.P.

Ph.: No.: +91-9971912476, 9350952231

E-mail: ultraresearchlab@gmail.com

Website: http://www.ultralabnoida.com

TEST REPORT

Bacteriological Quality of Drinking Water

Report Code : M-04062021-01

Issue Date : 07/06/2021

Issued To

: GOOD LUCK PUBLIC SCHOOL
B-20, BEGUMPUR EXT.
BARWALA ROAD, BEGUMPUR, DELHI

Sample Description : Drinking Water
Sample Received On : 04/06/2021
Sample Given By : Customer
Analysis Duration : 04/06/2021 To 07/06/2021

RESULTS

As per IS 10500:2012

S.No	Parameter	Test Method	Results	Units	Requirements
1	E.coli	IS-1622	Not detected (<2)	E.Coli/100ml	Shall not be detectable in 100 ml sample
2	Total Coliform	IS-1622	Absent	MPN/100ml	Shall not be detectable in 100 ml sample

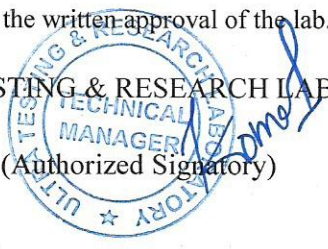
End Of Report

Note:-

- 1 The results given above are related to the tested sample, for various parameters, as observed at the time of sampling. The customer asked for the above tests only.
- 2 This test report will not be used for any publicity/legal purpose.
- 3 The test samples will be disposed off after two weeks from the date of issue of test report, unless until specified by the customer.
- 4 The Report can not be used as evidence in a court of law without the written approval of the lab.


Checked By

For ULTRA TESTING & RESEARCH LABORATORY


(Authorized Signatory)



SCHOOL HEALTH CERTIFICATE

D. No. DHO/NRZ/2019/.....1429.....

DATE:-20-12-19

DATE OF INSPECTION : 19/12/2019

1. NAME OF SCHOOL : **GOOD LUCK PUBLIC SCHOOL**
2. ADDRESS : **PLOT-B-20 BEGUM PUR EXTN. BARWALA ROAD, NEW DELHI-86**
3. NO. OF SHIFTS : ONE TIMING: 07:30 AM TO 01:30 PM

ACCOMODATION PROVIDED:-

THE FLOOR AREA IN THE CLASSROOM IS **SUFFICIENT.**

THE CLASSES ARE **WELL LIGHTED.**

THE CLASSROOMS ARE **WELL VENTILATED.**

THE CLASSROOMS ARE KEPT **NEAT AND CLEAN.**

THE DRINKING WATER IS Water test Report approved by **ULTRA Lab..**


THE TOILET ARRANGEMENT IS **SANITARY &HYGIENIC AND SUFFICIENT IN NUMBER.**

REMARKS: THIS CERTIFICATE DOES NOT INDICATES PERMISSIBILITY FROM LAND POINT OF VIEW.

The certificate is valid for a period of one year from the date of issue.

The VICE PRINCIPAL

**GOOD LUCK PUBLIC SCHOOL
PLOT-B-20 BEGUM PUR EXTN.
BARWALA ROAD, NEW DELHI-86**


**DY. HEALTH OFFICER
NARELA ZONE**

